

SONY

Radio/Tape Recorder Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: DD-100

No. 22



Subject: Output Is Muted After Play Is
Engaged

Date: July 29, 1988

Symptom:
(652)

With the volume level set above 8 and the DOL switch on, the audio may mute one second after pressing PLAY and then return to normal level.

Solution: Add a resistor as shown from the collector to emitter of Q402.

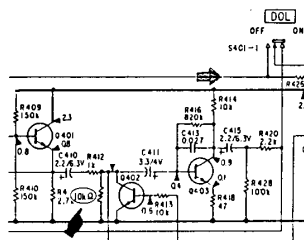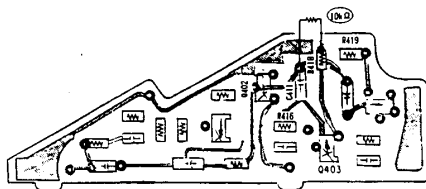

Description	Part Number
10k Ω 1/4W	1-249-429-11

Reference: 05088-0004

PRINTED IN U.S.A.
CSA-11788-5

Walkman

CSA-11